



**MEYLE**<sup>®</sup>  
Products

MEYLE No.

Reference No.

Bushing  
Repair kit


014 033 0024/HD  
014 033 0015/HD

140 333 18 14 26  
140 330 82 07

## Bushing, control arm to fit Mercedes W140, C140




**as OE**

  
**Problem**

Leakage of hydro fluid due to high dynamic strain and small bonding surface

**Effect**

- Steering vibration
- Impaired driving safety

  
**Solution**




- Hydro mount replaced by an optimised full-rubber mount with a larger bonding surface
- Replacement of plastic outer sleeve by steel sleeve

**Advantage**

- Leakage no longer possible
- Significantly longer service life without restriction of driving comfort

**as OE**

Hydro-liquid

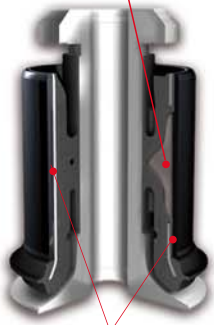

No compound between rubber and outer sleeve

**MEYLE-HD-version**

Steel sleeve



Full rubber mount, rubber to metal compound